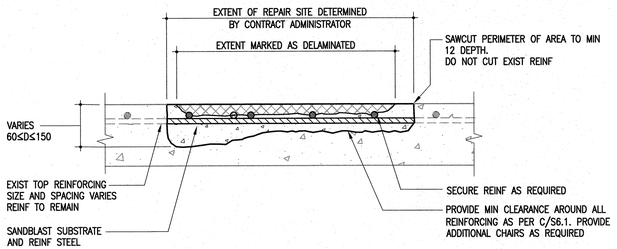

A TYPICAL TOP SURFACE REPAIR DETAIL

– | S6.1 1:100 (UNIT PRICE)

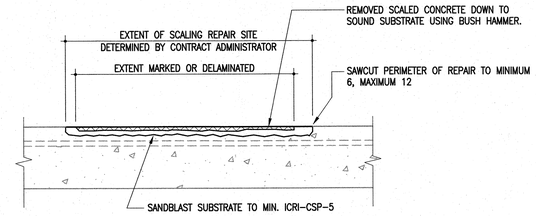

B TYPICAL SCALING REPAIR DETAIL

– | S6.1 N.T.S. (UNIT PRICE)

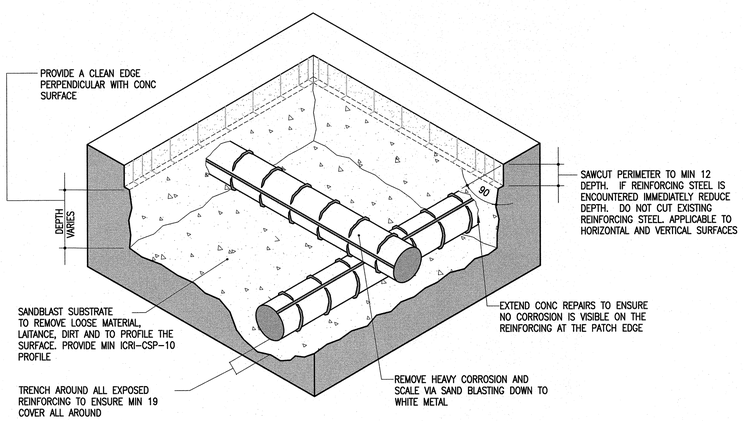

C TYPICAL SURFACE PREPARATION OF DELAMINATED CONCRETE

– | S6.1 N.T.S.

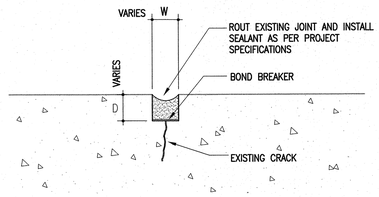

NOTES:

1. ANY EXISTING SEALANT MUST BE REMOVED PRIOR TO SAW–CUTTING JOINT OR CRACK.
2. EACH SIDE OF EXIST. JOINT OR CRACK MUST BE CUT.
3. SANDBLAST CONCRETE SURFACE TO PROVIDE CLEAN SOUND JOINT.
4. REMOVE LOOSE PARTICLES BY BLOWING OUT JOINT WITH OIL FREE COMPRESSED AIR.
5. INSTALL PRIMER, BOND BREAKER, AND SEALANT AS PER PROJECT SPECIFICATIONS.

D TYPICAL CRACK REPAIR DETAIL

– | S6.1 N.T.S. (UNIT PRICE)

The General Contractor shall check & verify all dimensions and report any errors or omissions to the designers.

No.	Date	Issue/Revision	By
0	2017-06-28	ISSUED FOR CONSTRUCTION	WB

APEGM
Certificate of Authorization
Crosier Kilgour & Partners Ltd.
No. 235 Date: 2017-06-28

PROVINCE OF MANITOBA
D.J. MIZAK
Member
20801
REGISTERED PROFESSIONAL ENGINEER

Consultant

300-275 Carlton Street
Winnipeg, Manitoba R3C 5R6
T 204. 943. 7501
F 204. 943. 7507

Crosier Kilgour & Partners Ltd.
CONSULTING STRUCTURAL ENGINEERS

Project
DYNASTY BUILDING
COURTYARD WATERPROOFING

180 KING STREET
WINNIPEG, MANITOBA

Sheet Title
TYPICAL CONCRETE REPAIR DETAILS

File	Date
2017-0306	2017-06-28
Design: WB	Drawn: RJM
Revision: 0	Sheet No.: S6.1