



**EXPANSION JOINT REPAIR NOTES:**


1. THE EXISTING DETAILS AND DIMENSIONS SHOWN ON ALL DRAWINGS ARE TAKEN FROM ORIGINAL CONTRACT DOCUMENTS AT TIME OF CONSTRUCTION. ACTUAL CONDITIONS MAY VARY. CONTRACTOR SHALL VERIFY EXISTING CONDITIONS BEFORE COMMENCING WITH THE WORK.

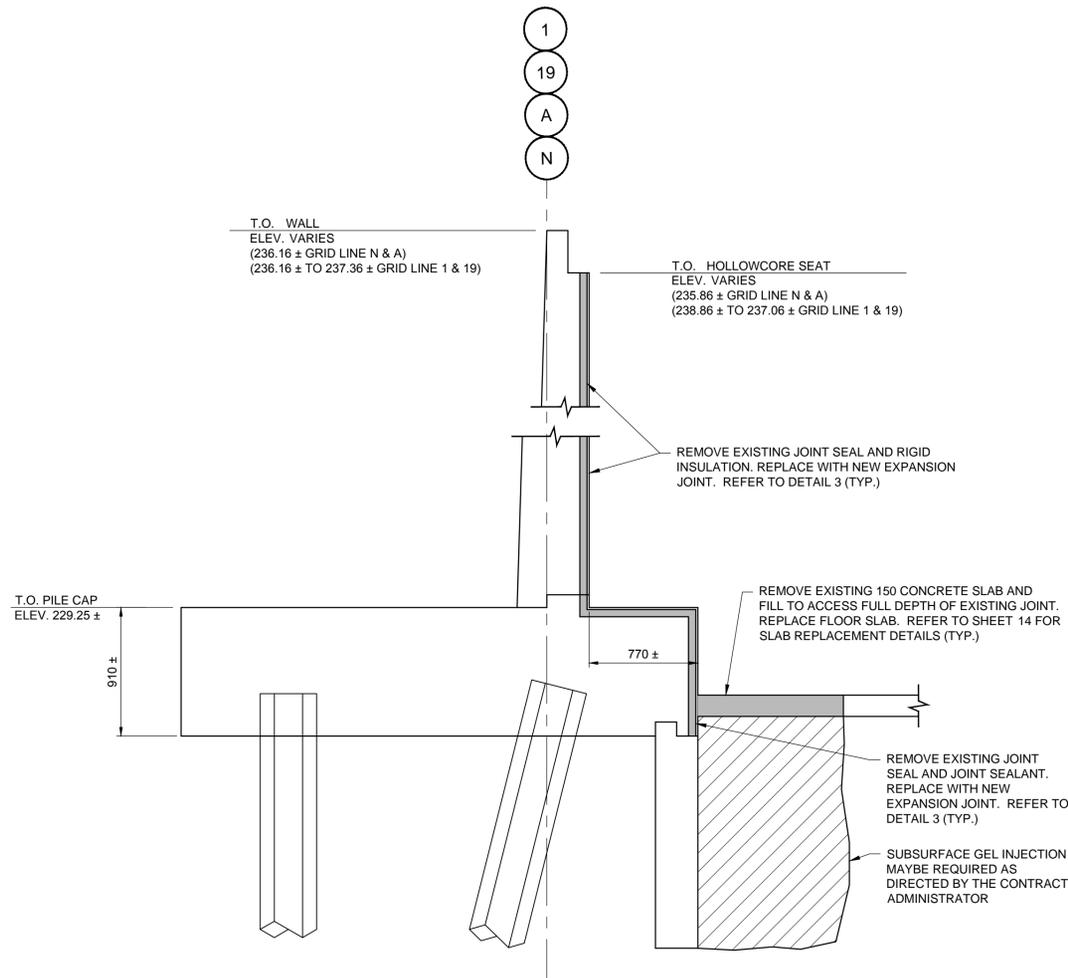


**1 SECTION**  
TYPICAL EXTERIOR WALL (8 THUS)

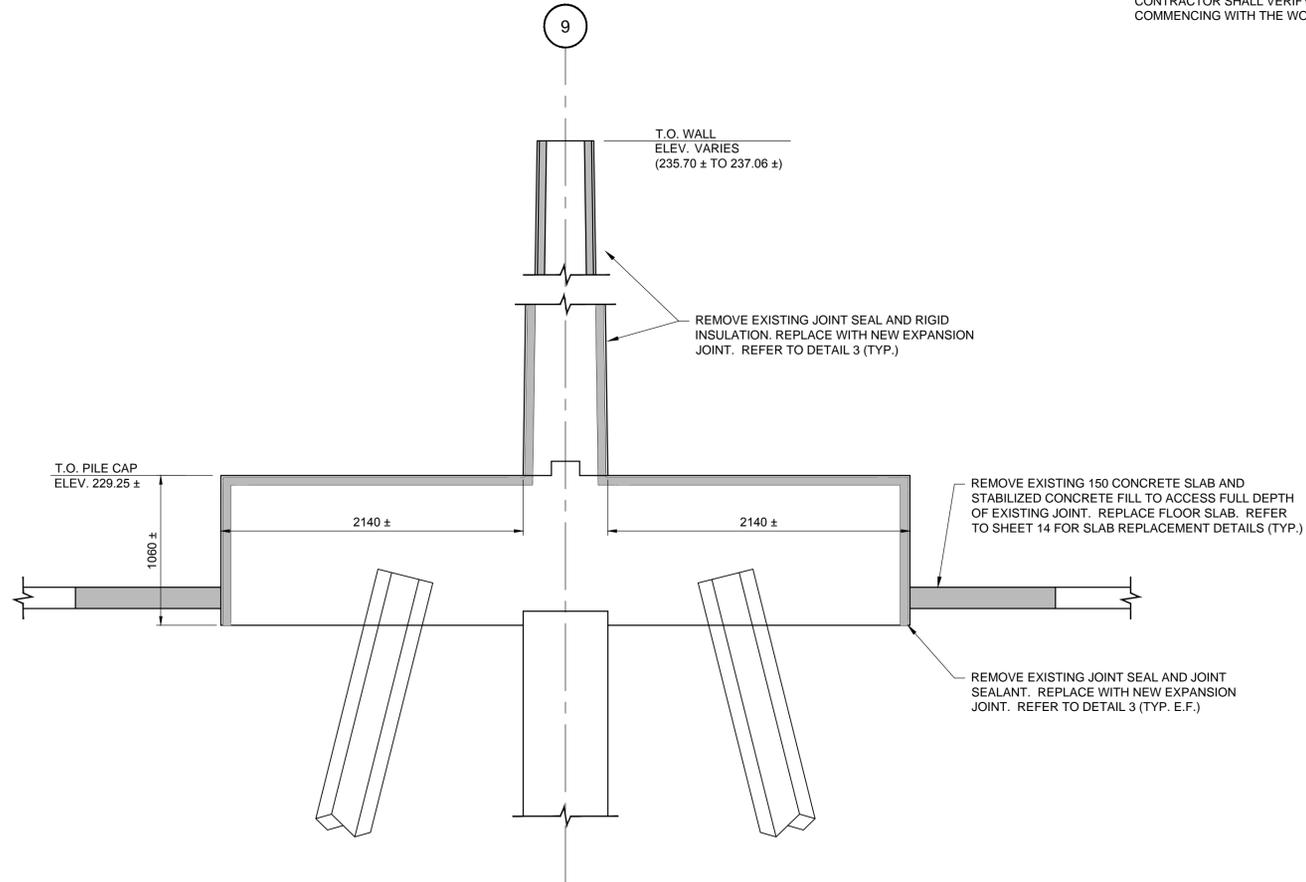


**2 SECTION**  
TYPICAL INTERIOR WALL

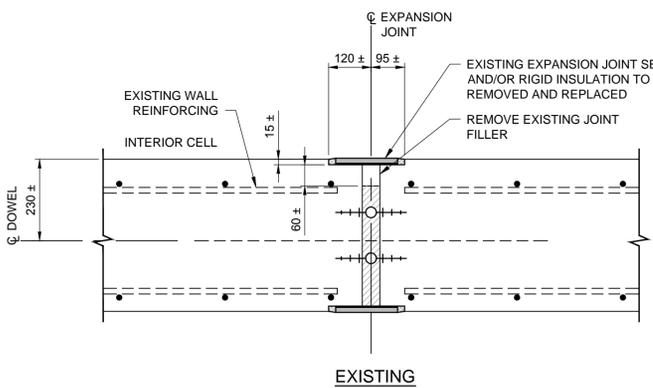


**3 DETAIL**  
EXISTING INTERIOR WALL AND FOOTING EXPANSION JOINT REPAIR

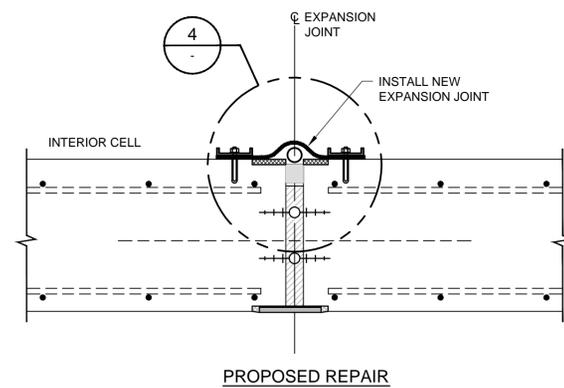

**4 DETAIL**  
PROPOSED REPAIR INTERIOR WALL AND FOOTING EXPANSION JOINT REPAIR

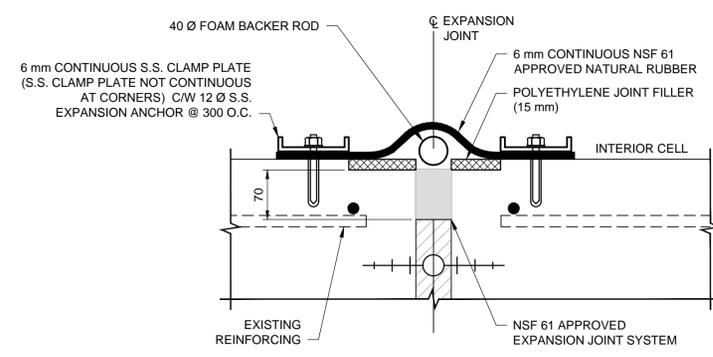

**4 DETAIL**  
TYPICAL EXPANSION JOINT REPLACEMENT

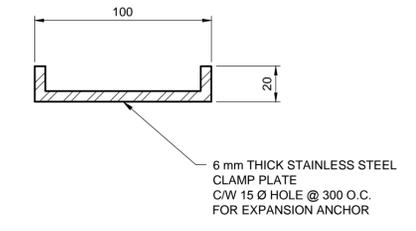

**5 DETAIL**  
STAINLESS STEEL CLAMP PLATE

**METRIC**  
WHOLE NUMBERS INDICATE MILLIMETRES  
DECIMALIZED NUMBERS INDICATE METRES

**APEGM**  
Certificate of Authorization  
Dillon Consulting Limited (MB)  
No. 1789 Date: 2015-11-20

**LOCATION APPROVED UNDERGROUND STRUCTURES**  
N/A  
SUPV. U/G STRUCTURES COMMITTEE DATE  
NOTE: LOCATION OF UNDERGROUND STRUCTURES AS SHOWN ARE BASED ON THE BEST INFORMATION AVAILABLE BUT NO GUARANTEE IS GIVEN THAT ALL EXISTING UTILITIES ARE SHOWN OR THAT THE GIVEN LOCATIONS ARE EXACT. CONFIRMATION OF EXISTENCE AND EXACT LOCATION OF ALL SERVICES MUST BE OBTAINED FROM THE INDIVIDUAL UTILITIES BEFORE PROCEEDING WITH CONSTRUCTION.

B.M. ELEV.	CHECKED BY	DRA
CONSTRUCTION COMPLETION DATE:	APPROVED BY	SSR
	DESIGNED BY	FAK
	DRAWN BY	TLK
	SCALE:	AS NOTED
	HORIZONTAL	
	VERTICAL	
1 ISSUED FOR TENDER	DATE	2015 11 20
NO.	REVISIONS	DATE BY

**DILLON CONSULTING**  
RELEASED FOR CONSTRUCTION  
DATE: 2015 11 18

ENGINEER'S SEAL  
CONSULTANT DRAWING NUMBER  
**14-1411-S-107**

**THE CITY OF WINNIPEG**  
WATER AND WASTE DEPARTMENT  
ENGINEERING DIVISION  
WILKES RESERVOIR NORTH CELL REHABILITATION  
FOOTING AND WALL JOINT REPLACEMENT  
SECTIONS AND DETAILS  
SHEET 15 OF 47  
CITY DRAWING NUMBER  
**1-0650R-S0007-001**