




OPTION A

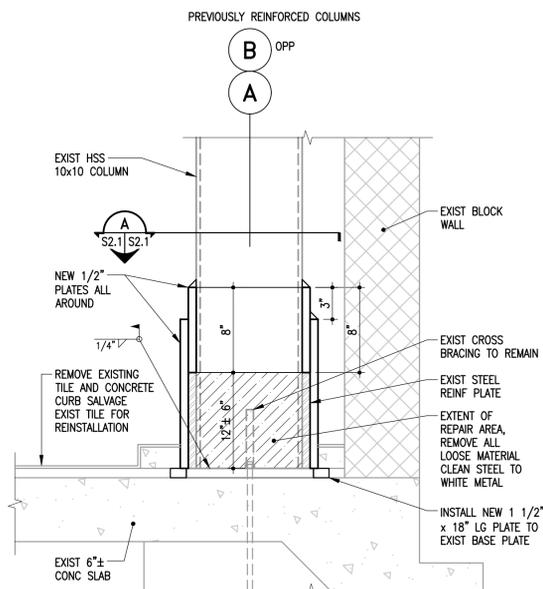


OPTION B

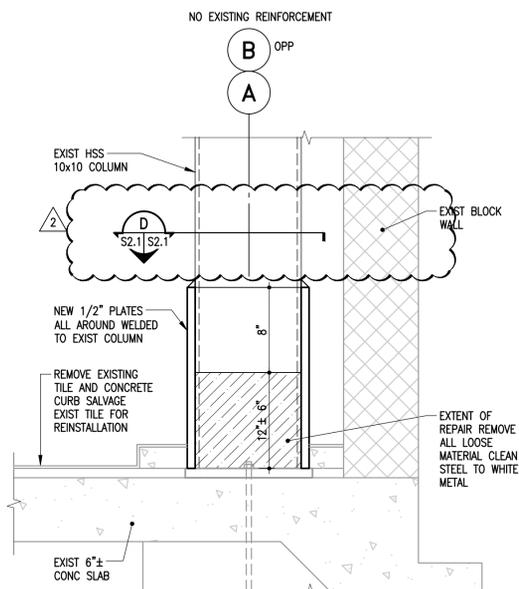


OPTION C

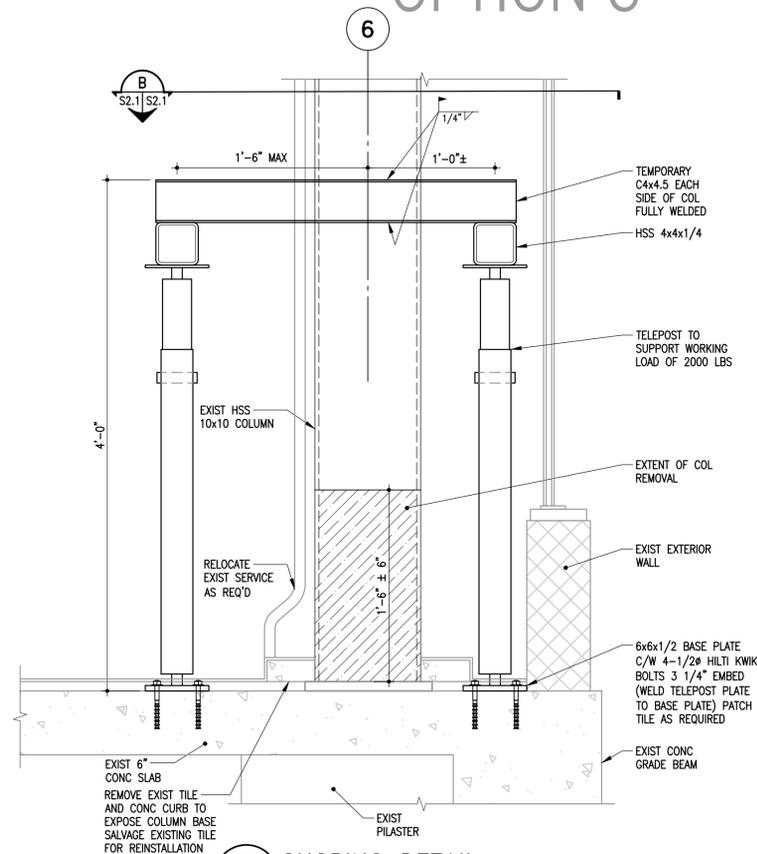


1 COLUMN REINFORCING AND REPAIR DETAIL

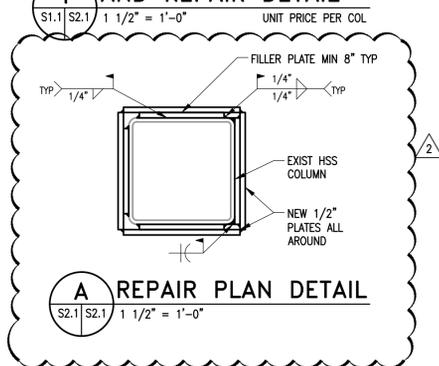

2 COLUMN REINFORCING AND REPAIR DETAIL

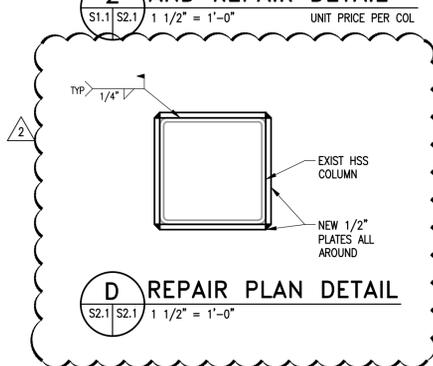

3 SHORING DETAIL

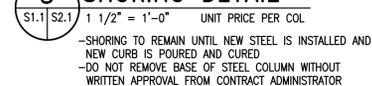

A REPAIR PLAN DETAIL


S2.1 | S2.1 1 1/2" = 1'-0"

D REPAIR PLAN DETAIL

S2.1 | S2.1 1 1/2" = 1'-0"


B SHORING PLAN DETAIL

S2.1 | S2.1 1 1/2" = 1'-0"

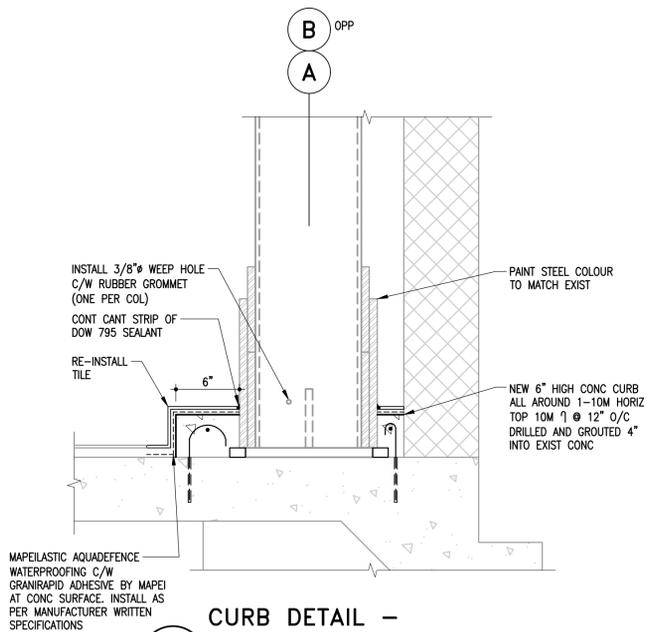

4 CURB DETAIL - OPTION A & B

- S2.1 1 1/2" = 1'-0"

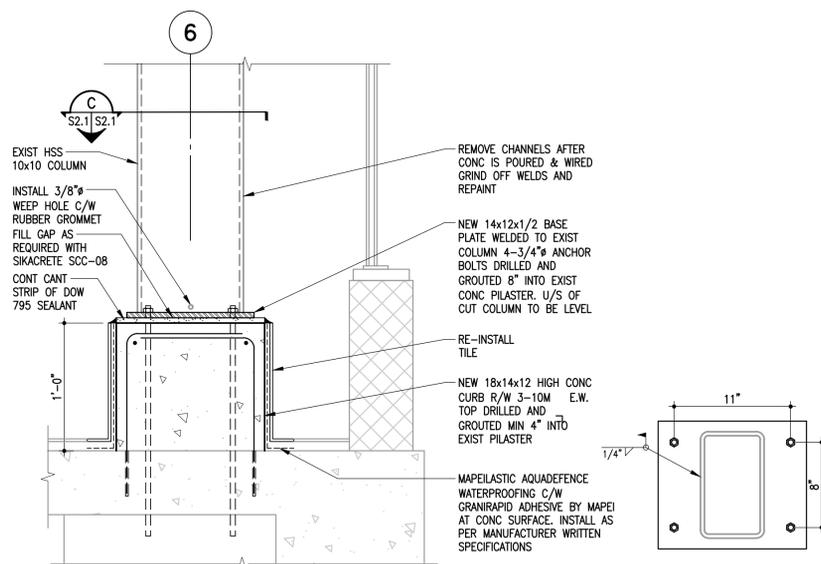

5 CURB DETAIL - OPTION C

- S2.1 1 1/2" = 1'-0"

C BASE PLATE PLAN

S2.1 | S2.1 1 1/2" = 1'-0"

The General Contractor shall check & verify all dimensions and report any errors or omissions to the designers.

No.	Date	Issue/Revision	By
2	2018-07-02	ISSUED FOR ADDENDUM 2	SMC
1	2018-06-21	ISSUED FOR CONSTRUCTION	SMC
0	2018-06-15	ISSUED FOR BID OPPORTUNITY	SMC

ORIGINAL DRAWING SEALED BY S.M.A. CABIGTING AND DATED 2018-06-21

300-275 Carlton Street
Winnipeg, Manitoba R3C 5R6
T 204-943-7501
F 204-943-7507

Crosier Kilgour & Partners Ltd.
CONSULTING STRUCTURAL ENGINEERS

Project
ST. JAMES CENTENNIAL POOL
STEEL COLUMNS REPAIR

644 PARKDALE
WINNIPEG, MANITOBA

Sheet Title
SECTIONS AND TYPICAL REPAIR DETAILS

File	2018-0383	Date	2018-07-02
Design	SMC	Drawn	MAH
Revision	2	Sheet No.	S2.1